


MS8239A

Digital Multimeter
User's Manual

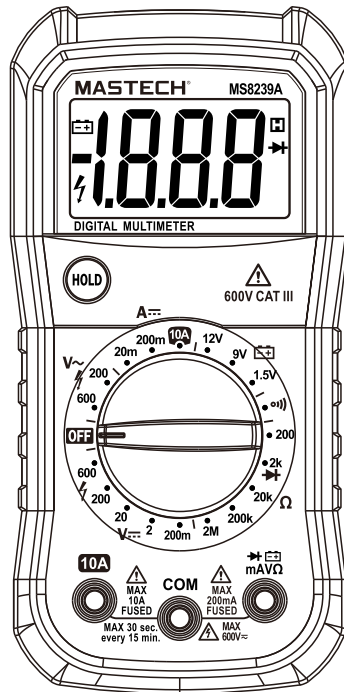

CONTENTS

Overview.....	1
Safety Indicators.....	1
Safe Working Habits.....	2
Electric Symbols.....	4
Meter Instructions.....	5
Meter Appearance.....	5
Display.....	5
Measuring Operation.....	7
Data Hold.....	7
DC/AC Voltage Measurement.....	7
DC Current Measurement.....	8
Resistance Measurement.....	9
Continuity Measurement.....	10
Diode Test.....	10
Battery Test.....	11

CONTENTS

General Specifications.....	11
Accuracy Indicators.....	12
DC Voltage.....	13
AC Voltage.....	13
Resistance Measurement.....	14
Diode.....	14
Continuity Measurement.....	14
DC Current.....	15
Battery Test.....	15
Maintenance.....	15
General Maintenance.....	16
Replace Battery.....	16
Replace Fuse.....	17
Replace the Probe.....	17
Accessories.....	18

Overview

 **Warning**

To avoid electrical shock or personal injury, please read all safety information, warnings and precautions carefully before using the meter. If the equipment is used in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired.

The multimeter is a small hand-held, safe and reliable 3.5" digital multimeter with stable performance and novel structure. It can be used to measure AC/DC voltage, DC current, resistance, diode forward voltage drop, circuit continuity and test batteries. This tool is ideal for professionals and hobbyists alike.

Safety Instructions


The multimeter has been designed according to International Electro safety standards EN/UL/CSA 61010-1, 61010-2-030, 61010-2-033 concerning safety requirements for electronic measuring instruments. It meets CAT III 600V installations and a pollution degree of 2.

- Users should use the meter strictly according to the provisions of this manual. Otherwise, the warranty for the meter may become invalid.
- The warnings in the user manual are used to remind users of possible dangers or dangerous actions.
- The notes in the user manual are to remind users of conditions or actions that may cause damage to the measured object.











Safe Working Habits

To avoid possible electric shock or personal injury as well as damage to the meter or measured objects, please use the meter according to the following procedures:

- Check the case before using the meter. Don't use the meter with damaged case. Check to see if the case is cracked or lacks plastic parts. Please pay special attention to the joint insulating layer.
- Check to see if the test wire has insulation damage or bare metal. Check test wire continuity. If the wire is damaged, please replace it with a new one before using the meter.
- Measure known voltage with the meter to verify that the meter is working properly. If the meter is working abnormally, stop using it immediately. A protective device may be damaged. If there is any doubt, please have the meter inspected by a qualified technician.
- Do not test voltage exceeding rated voltage marked on the meter.
- When testing voltage exceeding 30v AC voltage RMS, 42v AC peak or 60v DC, be particularly careful to avoid electric shock.
- When measuring, use correct jack, and select the proper function and measuring range.
- Do not use the meter in explosive gas, vapor or dusty environments.
- When using the probe, fingers should be behind the probe protection device.


- When connecting circuits, connect the common test line first, then connect the charged test line. When disconnecting circuits, disconnect the charged test line first, then disconnect the common test line. Before measuring resistance, continuity, and diodes, first turn off power and discharge all high voltage capacitors.
- If the meter is not used in accordance with the instructions, the meter's safety protective function may become invalid.
- For all DC measurements, to avoid the risk of electric shock, please use AC function to verify the existence of any AC voltage. Then, select DC voltage measuring range equal to or greater than the AC measuring range.
- Before measuring current, please check the meter fuse, shut off power to the circuit to be tested, then connect the meter and energize the circuit.
- When opening the case (or part of the case), turn the meter off.
- When the battery low voltage indicator “” becomes lit, replace the battery at once. A low battery will cause meter reading errors and may result in electric shock or personal injury.
- Before opening the case or the battery cover, remove the test wire from the meter. When maintaining the meter, use replacement parts specified by the factory.

Electric Symbols

	Important safety information.
	High voltage with danger.
	Ground.
	Double Insulation (Class II safety equipment).
	Fuse must be replaced as per the specification herein.
	Accord with the related EU laws and regulations
	AC (Alternating Current)
	DC (Direct Current)
	AC & DC (Both direct and Alternating Current)
	Conforms to UL STD. 61010-1, 61010-2-030 and 61010-2-033; Certified to CSA STD. C22.2, NO. 61010-1, 61010-2-030 and 61010-2-033
CAT III	It is applicable to test and measuring circuits connected to the distribution part of the building's low-voltage MAINS installation.


Meter Instructions

Meter Appearance

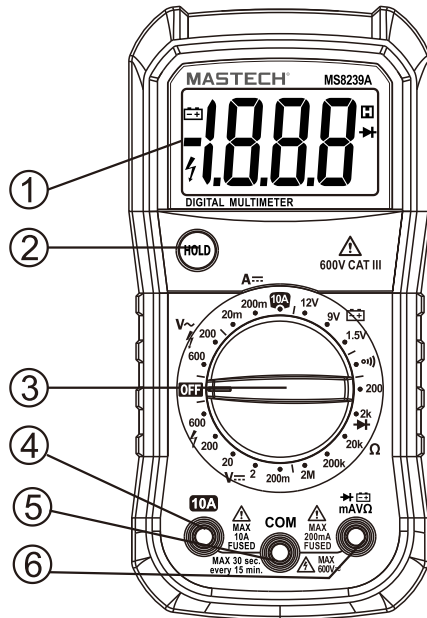

- (1) LCD display
- (2) Data hold key
- (3) Function selection rotary switch
- (4) Positive input jack of 10A (connected with the red test probe).
- (5) All the common input jacks for measuring (connected with the black test probe).
- (6) Positive input jack of voltage, resistance, mA current, diode, continuity and battery test (connected with the red test probe).

Display

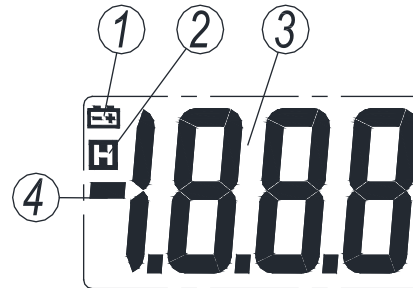

- (1) Battery low voltage indicator
- (2) Data hold indicator
- (3) Numerical value display
- (4) Numerical value polarity indicator (negative sign)

Measuring Operation

Data Hold

The data hold function can keep the current readings on the display. To enter and exit reading maintenance mode:

- ① Press the "HOLD" key, the reading will be stored and "H" symbol will display on the LCD display.
- ② Press the "HOLD" key again to return the meter to the normal measurement state.

AC/DC Voltage Measurement:

- ① Rotate the function selection switch to appropriate AC or DC voltage measurement position.
- ② Connect the black and red test probes to the COM input jack and VΩmA input jack, respectively..
- ③ Measure the voltage of circuit to be tested with other ends of test probes (connected with the circuit to be tested in parallel).
- ④ Read the measured value from the LCD display. When measuring the DC voltage, the display will simultaneously show the voltage polarity which is connected with the red test probe.

⚠ Warning

Don't measure any RMS voltage higher than 600V DC or AC, to prevent injury or damage to meter and equipment.

DC Current Measurement:

- ① Turn off the power to the circuit to be tested. Discharge all the high voltage capacitors on the circuit to be tested.
- ② Rotate the function selection switch to the appropriate DC current position.
- ③ Depending on the size of the current to be measured, connect the red test probe to 10A or mA input jack; connect the black test probe to COM input jack.
- ④ Turn off the circuit to be tested. Connect the black test probe to one end of the disconnected circuit (low voltage relatively), and the red test probe is connected to the other end of disconnected circuit (high voltage relatively). (Reversing test probes would make reading become negative, but the meter won't be damaged.)
- ⑤ Connect the power supply to the circuit, then read the display reading. If the display shows only "1", the input is out of the selected input range. In this case, rotate the switch to a higher measuring range.

⚠ Warning

To prevent injury or damage to meter and equipment, do not make current measurements if voltage exceeds 250V.

Note

Before measuring current, first check the meter's fuse. When measuring, use correct input end and function. When the test probe is inserted to the current input end, don't connect the other end of the test probe with any circuit in parallel.

Resistance Measurement:

- ① Rotate the function selection switch to an appropriate resistance position, and turn off the power to the circuit to be tested
- ② Connect the black and red test probe to COM input jack and V Ω mA input jack, respectively.
- ③ Measure the resistance of the circuit with other ends of test probes.
- ④ Read the resistance value from the LCD display.

Here are some tips for measuring resistance:

- The resistance measured on a circuit is usually different from the rated value of resistance. This is because the test current of the meter will flow through all the possible channels between the test probes.
- When measuring low resistance, to ensure the accuracy of the measurement, make a short circuit between the test probes and read the resistance value of the short circuit. This resistance value should be subtracted after measuring the resistance to be tested.

- When there is no input (for example, open circuit), the display will show "1", which means that the measured value is out of range.

⚠ Warning

When measuring resistance or circuit continuity, to avoid injury or meter damage, turn off the power to the circuit and discharge all capacitors.

Continuity Measurement:

- ① Rotate the function selection switch to continuity measurement position, and turn off the power to the circuit to be tested
- ② Connect the black and red test probe to COM input jack and V Ω mA input jack, respectively.
- ③ Measure the circuit to be tested with other two ends of the test probes.
- ④ If the measured circuit resistance is less than about $50\Omega \pm 20\Omega$, the buzzer will sound continuously.

⚠ Warning

When measuring resistance or circuit continuity, to avoid injury or meter damage, turn off the power to the circuit and discharge all capacitors

Diode Test:

- ① Rotate the function selection switch to diode position, and turn off the power to the circuit to be tested
- ② Connect the black and red test probe to COM input jack and V Ω mA input jack, respectively.

- ③ Connect the black and red test probe to cathode and anode of the diode to be tested, respectively. The meter will display the diode's forward bias voltage value. If the test probe polarity is reversed, the meter will display "1", which distinguishes the diode's cathode and anode.

⚠ Warning

When measuring diodes, to avoid injury or meter damage, turn off the power to the circuit and discharge all capacitors.

Battery Test

- ① Place the function measuring range switch to the battery testing position.
- ② Insert the red probe to VΩmA input jack. Insert the black probe to COM input jack.
- ③ Connect free end of the red probe to positive and the free end of the black probe to negative end of the battery to be tested.
- ④ Read the result from the LCD display.

⚠ Warning

Don't input voltage higher than 60V DC or 30V AC, to prevent electric shock or meter damage.

General Specifications

- Operating environment and condition: 600V CAT III, pollution grade: II.
Elevation < 2000 m

- Environmental temperature and humidity: 0~40°C, <80% RH (do not use meter when temperature <10°C).
- Storage temperature and humidity: -10~60°C and <70% RH (remove the battery).
- Temperature coefficient: 0.1XAccuracy /°C(<18°C or >28°C).
- The maximum allowable voltage between measurement end and ground: 600V DC or 600V AC RMS.
- Fuse protection: grade mA: FF 400mA H 600V grade 10A: FF 10A H 600V
- Sampling rate: about 3 times/s.
- Display: 3.5" digital LCD display.
- Over-range indication: LCD will show "1".
- Low battery indication: When the battery voltage is lower than the normal operating voltage, "🔋" will display on the LCD display.
- Input polarity indication: automatically display "-".
- Power supply: 2 X 1.5V AAA batteries.

Accuracy Indicators

Accuracy: ±(% of reading + digits) with one year of warranty. Reference conditions: environmental temperature is from 18°C~28°C, relative humidity is not more than 80%.

DC Voltage

Measuring range	Resolution	Accuracy
200mV	0.1mV	±(0.5% of reading +3 digits)
2V	0.001V	
20V	0.01V	
200V	0.1V	
600V	1V	±(0.8% of reading +3 digits)

Input impedance: 1MΩ

Maximum input voltage: 600V DC or AC RMS, 250V DC or AC RMS with the measuring range of 200mV.

AC Voltage

Measuring range	Resolution	Accuracy
200V	0.1V	±(1.2% of reading +10 digits)
600V	1V	

Input impedance: 1MΩ

Maximum input voltage: 600V DC or AC RMS, 250V DC or AC RMS with the measuring range of 200mV.

Frequency response: 40Hz~400Hz, sine wave RMS (average response)

Resistance

Measuring range	Resolution	Accuracy
200Ω	0.1Ω	±(0.8% of reading +5 digits)
2kΩ	0.001kΩ	
20kΩ	0.01kΩ	
200kΩ	0.1kΩ	
2MΩ	0.001MΩ	

Overload protection: 250V DC or AC (RMS)

Diode

Function	Measuring range	Resolution	Test Environment
Diode Test ➔	2.5V	0.001V	Forward DC current: about 1mA; Reverse DC voltage: about 2.5V. Display approximation of diode forward voltage drop.

Overload protection: 250V DC or AC (RMS)

Continuity Measurement

Function	Description	Test Environment
🔊)	When built-in buzzer sounds, the resistance to be tested is less than about 50Ω ± 20Ω.	Open circuit voltage: about 2.5V

Overload protection: 250V DC or AC (RMS)

Direct Current

Measuring range	Resolution	Accuracy
20mA	0.01mA	±(1.0% of reading +5 digits)
200mA	0.1mA	
10A	10mA	±(2.0% of reading +10digits)

Overload protection: grade mA: Fuse (FF 400mA H 600V) protection; grade 10A: Fuse (FF 10A H 600V) protection.

Maximum input current: grade mA: 200mA DC or AC RMS; grade 10A: 10A DC or AC RMS

When measured current is greater than 2A, the continuous measurement time cannot be not more than 2 minutes. Disconnect the current and wait 10 minutes before making another measurement.

Battery Test

Measuring range	Resolution	Built-in load resistance
12V	0.01V	300Ω
9V	0.01V	1.8kΩ
1.5V	0.001V	36Ω

Overload protection: Fuse (FF 400mA H 600V) protection.

Maintenance

This section provides basic maintenance information, including instructions for the replacement of fuse and battery. Do not try to repair the meter unless you are an experienced maintenance person with the relevant calibration, performance testing and maintenance data.

General Maintenance

⚠ Warning

To avoid injury or damage to the meter, don't wet the inner parts of the meter. Before opening the case or battery cover, remove the connecting cable between the test probe and the input signal.

Regularly clean the meter case with damp cloth and a small amount of detergent. Do not use abrasives or chemical solvents. If the input jack becomes dirty or wet, it may affect the measurement readings.

To clean input socket:

- ① Turn off the meter and pull out all the test probes from the input jack.
- ② Remove all dirt from the jacks.
- ③ Apply detergent or lubricant to a new cotton ball (such as WD-40).
- ④ Clean each jack with a cotton ball and lubricant to prevent contamination by moisture in the socket.


Replace Battery

⚠ WARNING

To avoid electric shock, make sure that the test leads have been clearly move away from the circuit under measurement before opening the battery cover of the meter.

⚠ WARNING

Do not mix old and new batteries. Do not mix alkaline, standard (carbon-zinc), or rechargeable (ni-cad, ni-mh, etc) batteries.

If the sign “” appears, it means that the batteries should be replaced.
Loosen the fixing screw of the battery cover and remove it.
Replace the exhausted batteries with new ones.
Put the battery cover back and fix it again to its origin form.

Note:

Do not reverse the polarity of the batteries.

Replace Fuse

Warning

To avoid electric shock or personal injury, before opening back cover to replace fuse, turn off the meter and disconnect the test probe from the measurement circuit.

To replace fuse:

- ① Turn off the power to the meter.
- ② Remove all test probes from the input jacks.
- ③ Loosen screws on the back cover with screwdriver.
- ④ Remove the back cover.
- ⑤ Remove the blown fuse.
- ⑥ Replace with new fuse with the same type.
- ⑦ Put the back cover and tighten the screws.

Replace the Probe

If insulation on probe is damaged, replace it.

WARNING

Use meet EN 61010-031 standard, rated CAT III 600V, 10A or better probe.

Accessories

• Test Leads	1set
• Package	1pcs
• 1.5V AAA Battery	2pcs
• User's Manual	1pcs



R-00-05-1669