Hydrogen Sulfide Gas Sensor

(Model: ME4-H₂S)

Manual

Version: 1.2

Valid from: 2014-05-01

Statement

This manual copyright belongs Zhengzhou Winsen Electronics Technology Co., LTD. Without the written permission, any part of this manual shall not be copied, translated, stored in database or retrieval system, also can't spread through electronic, copying, record ways.

Thanks for purchasing our product. In order to let customers use it better and reduce the faults caused by misuse, please read the manual carefully and operate it correctly in accordance with the instructions. If users disobey the terms or remove, disassemble, change the components inside of the sensor, we shall not be responsible for the loss.

The specific such as color, appearance, sizes &etc, please in kind prevail.

We are devoting ourselves to products development and technical innovation, so we reserve the right to improve the products without notice. Please confirm it is the valid version before using this manual. At the same time, users' comments on optimized using way are welcome.

Please keep the manual properly, in order to get help if you have questions during the usage in the future.

ME4-H₂S Hydrogen Sulfide Gas Sensor

Profile

ME4-H₂S hydrogen sulfide gas sensor is constant potential electrolysis type. Oxidation-reduction reaction with hydrogen sulfide and oxygen take place respectively on the working electrode and on the counter electrode. The process releases electric charge and generates current. The current is in direct proportion to the concentration of hydrogen sulfide. So the concentration of the target gas could be got by measuring the value of current.



Features

Low power consumption, high precision, high sensitivity, wide linear range, good anti-interference ability, excellent repeatability and stability.

Main applications

It is used for hydrogen sulfide detection in industrial occasions, mine and environmental protection field.

Technical Parameters Stable 1.

Detection Gas	Hydrogen Sulfide(H2S)	
Detection Range	0∼100ppm	
Max range	500ppm	
Sensitivity	(0.8±0.15)μA/ppm	
Resolution	0.1ppm	
Response Time(T ₉₀)	<30\$	
Bias Voltage	0mV	
Load Resistance	10Ω(recommended)	
Repeatability	<2 % Output value	
Stability(/month)	<2%	
Output Linearity	Linear	
Zero drift(-20°C ~40°C)	≤0.2ppm	
Temperature range	-20℃~50℃	
Humidity range	15 % ∼90 % RH	
Pressure range	standard atmospheric pressure±10%	
Lifespan	2years(in air)	
•		

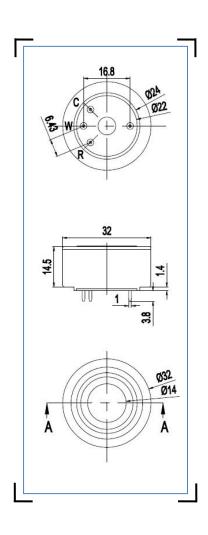


Fig1.Sensor Structure

Basic Circuit



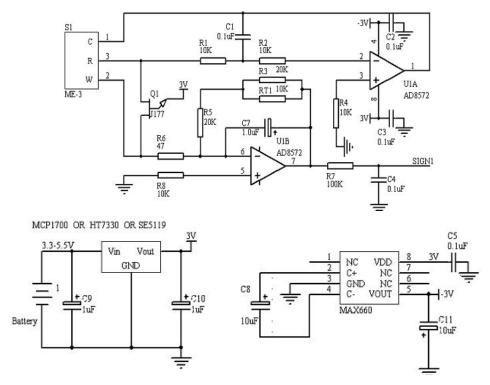


Fig2: ME4-H₂S test circuit

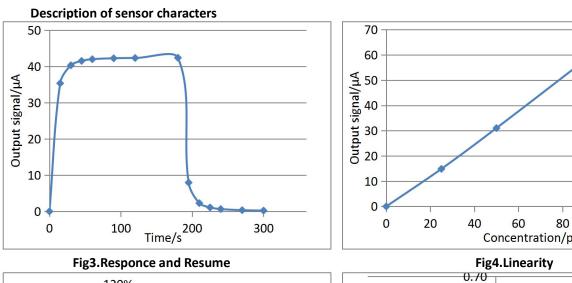

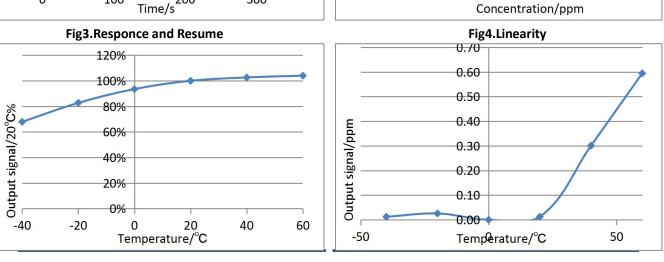

100

120

Fig5.Output of sensor at different temperature Fig6.Zero output of sensor at different temperature Cross Interference

ME4- H_2S sensor also can respond to other gases besides target gas H_2S . Following data are the response characteristics of the sensor to interferential gases at certain concentration for your reference.

Stable2. Cross interference

Interferential Gas	Concentration	ME4-H ₂ S
СО	200ppm	<0.5 ppm
Cl_2	10 ppm	<-0.7 ppm
C_2H_4	400 ppm	<0.3 ppm
H_2	10000 ppm	<5 ppm
Alcohol	1000 ppm	<0.3 ppm
NH_3	50 ppm	<-0.3 ppm
H ₂ S	20 ppm	<1.6 ppm
PH_3	20 ppm	<14 ppm
Methanal	10 ppm	<2.5 ppm
Benzene	100 ppm	<0.2 ppm
Methanol	200 ppm	<0.15 ppm

Cautions!

- Tin soldering is prohibited.
- Before using, power on to aging for more than 48 hours is necessary.
- Pins can't be broke off or bent.
- Don't disassemble the sensor to avoid the damage caused by electrolyte leakage.
- Avoid contacting organic solvent (including Silicone rubber and other adhesive), coatings, medicine, oil and high concentration gases.
- All the electrochemical sensors shall not be encapsulated completely by resin materials, and shall not immerse in pure oxygen environment, otherwise, it will damage the function of sensor
- All electrochemical sensors shall not be applied in corrosive gas environment, or the sensor will be damaged
- Zero calibration should be finished in clean air.
- During test and usage, sensors should avoid the gas inflow vertically
- The side for inflow can't be choked and polluted.
- The laminating film above the sensor surface can't be uncovered and damage.

- Excessive impact or vibration should be avoided
- It takes some time for the sensor to return to normal state after it is applied in high concentration gas
- Working electrode and reference electrode of the sensor shall be in short circuit when stored
- Prohibit to use the hot cement or sealant of which the curing temperature is higher than 80 °C to make the capsulation for the sensor.
- Prohibit storage and usage for long time in alkaline gases with high concentration.
- Do not use the sensor when the shell is damaged